

# Manhole Inspection Summary

Manhole # S27G1\_013MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **27G1** Node: **013** Status: **Found**

Insp Date: **3/4/09 1:11 PM**

Incomplete Comments

Crew: **SD WJ**  
Inspector: **Lamont**  
Firm: **URS**

**Location** Address: **KLOMAN ST**

Cross Street: **WATERVIEW**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **22** Missing: **0** ☐ Corroded

**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View



Top View



GRADE ADJUSTMENT



Defect 2



INFILTRATION ON BARREL FROM MORTAR

# Manhole Inspection Summary


Manhole # S27G1\_013MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



HEAVY SPLASH DUE TO FLOW FROM 16  
PIPE

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **28.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ ~~Gravy~~ ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



DROP EXTENSION CLOGGED

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **21.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ ~~Gravy~~ ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Inside** Rod and Bar  
Angled: **Yes** Reading: **27.00** (ft.)  
Inv Depth: **28.00** (ft.)  
Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary


Manhole # S27G1\_013MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe In @ 9 O'Clock

9 O'Clock Inflow

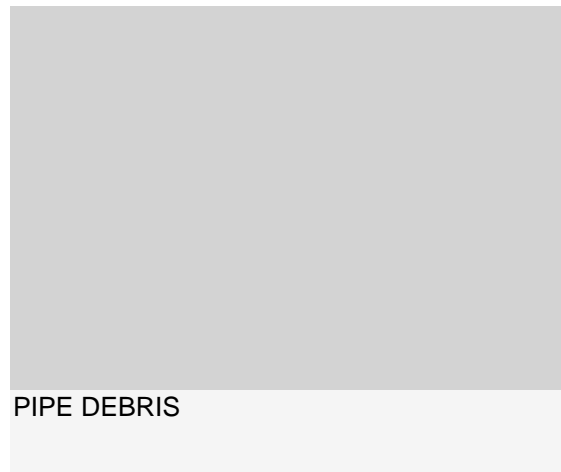

Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **27.80** (ft.) Flow Characteristics: **Fast**  
Deposits: ☐ None ☐ Mud ☒ ~~Sludge~~ **Debris** ☐ Grease  
Silt Depth: **4** (in.) Deposits Extent: **Heavy**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**  
☐ Possible Illicit Connection